

Details of Train Accidents 2019-20

A. Details of Consequential Train Accidents

1	20.04.19	CRS D-1	Derailment (Rooma) -Train no. 12303 UP derailed by 12 coaches in UP line between UP Starter and Advance Starter Signal of Rooma station. Preliminary report received on 20.05.19. (Grievous- 2, Simple 3) Cause: Due to bent of 4.5 mm in the leading axle of trailing trolley of coach no. ER 15276 (S-8) 11 th from EP.
		PRYJ	
2	26.04.19	SAG A-3	Side Collision (Rairu-Birlanagar) – Derailment of 4 wagons of UP E/BOXN between RRU-BLNR section and dashing of Loco of train no. 12155 with derailed E/BOXN over JHS division. Cause: i. Derailment due to breakage of auxiliary reservoir support bracket. ii. Side collision due to negligence of Crew.
		JHS	
3.	09.05.19	JAG B-3	Fire (Kailhat) :-While passing train no 12505 at Kailhat, ASM observed fire in front power car. Cause: Due to fault in diesel engine of set –B DG set.
		PRYJ	
4.	10.05.19	JAG D-3	Derailment (Agra City) -Derailment of leading wheel of leading trolley of 2 nd coach no. 31318 NR at KM no. 1348/41 of train no 64955 MEMU. Cause: P. Way defect & coach defect.
		AGC	
5	28.08.19	JAG D-3	Derailment (Kanpur) -Derailment of two caches of train no 64201 MEMU passenger at point no 129 of Kanpur. Cause:- Defect in wheel.
		PRYJ	
6	01.10.19	CRS E-1	Side Collision with truck (Rairu-Birlanagar) - While the train no. 22181 DN (Jabalpur-Nizamuddin Exp.) was on run in block section, one empty truck (no. AP -07 TH 7569) which was trespassing on formation of under construction, third line adjacent to DN track side grazed with the train engine and 04 coaches at Km no. 1233/18-20. Cause: Trespass by truck onto railway formation under construction (RVNL).
		JHS	
7	15.12.19	JAG D-3	Derailment (Aligarh Jn.) - Derailment of both trolleys of coach no 31376 NR (2 nd from rear) of train no 64152 MEMU passenger at point no 290B of ALJN station. Cause:- Obstruction caused by the tightly packed bundles of cloths on the track by unknown person.
		PRYJ	

B. Details of Non-Consequential Train Accidents

Other train accident (09)			
1	03.05.19	JAG D-5	Derailment (Matatila-Talbehat) :- Derailment of one BCNHL wagon of train no. E/BCNHL between Matatila-Talbehat section. Cause:- Mis-alignment in track due to box pushing work of LHS no 346.
2	17.05.19	JAG D-5	Derailment (GMC Yd.) :- Wagon no. SECR 22141470320 BOXNHL/E, (18 th from EP) of train no. GN-137 DN Goods derailed towards DLI end wheel of HWH end trolley in North line at GMC yard. Cause:- While moving coal shifted in one side due to which wheel lifted and derailed.
3	20.06.19	Jr. Scale D-5	Derailment (BhimsenYd.) :- Derailment of one empty wagon no. 33046248 of train no. ETW Spl at point no.294 in BZM Yard. Cause:- Track clogged with cement which misguided the wagon causing derailment.

4	26.08.19	Sr. Scale D-5	Derailment (Bhimsen Yd.): - Derailment of B/Van of train no KB Spl Goods at BZM Yd. Cause: -Metal deposition on wheel and not checked by crew while preparing GDR.
5	29.08.19	Jr. Scale D-5	Derailment (NYN Yd.): - Derailment of one wagon of train no DN GN-255 Goods at NYN main line. Cause: -Due to sudden jump of West End Trolley Wheels of Wagon no.910023 WR, and sudden breakage of Wagon's Brake Hanger Assembly.
6	03.09.19	Sr. Scale D-5	Derailment (MakkhanpurYd.): Derailment of 4 th wagon from Brake Van of train no. MSTB goods at point no. 203 b at Makkhanpur station. Cause – Centre Pivot of culprit wagon not properly negotiated the curve.
7	08.09.19	Sr. Scale D-5	Derailment (Mathura-Bhaisa): Derailment of two wagons of E/BCN goods between MTJ-BSA at Km 354/5-6. Cause – Due to stray animal OX dashed with wagon.
8	10.01.20	SAG D-5	Derailment (Sandapur-Antri): Derailment of two wheels of BOX no. 16 th and hanging of DV of 18 th wagon from brake van of train no. E/BOXN Goods. Cause: Unauthorized tractor fallen down from the road and dashed with EBOXN. Some part of the debris of the tractor entangled with the wagon, resulted into derailment.
9	11.01.20	Sr. Scale D-5	Derailment (GMC Yd.): While reception in line no. 23 of GMC 'B' cabin from Bhimsen station, Diesel power No.70651/WDG4D/IZN and wagon No. 30079360200/SE in rear of Diesel power of train no. BGS Goods derailed. Cause:- Due to excessive check rail clearance in front of acute CMS crossing of point no. 89L88.
Indicative: (07)			
1	24.04.19	Sr. Sub. G-3	BOBR:- Entering of train no. 12625 Dn in Engineering block at Morena yard. Cause:- Carelessness of Operating and Engineering staff.
2	14.05.19	JAG H-1	SPAD:- LP of train no. 64581 MEMU overshoot starter signal of 3 rd line of Ajalpur station. Cause:- Negligence of Moterman.
3	01.12.19	JAG H-1	SPAD:- LP of train no. 12826 Exp overshoot starter signal for 81 metres of 2 nd loop line of Jeonathpur station. Cause:- Negligence of LP & ALP.
4	01.01.20	SAG H-1	SPAD:- LP of train no. 12301 UP Kolkata Rajdhani overshoot modified automatic signal no. A-509 between Maitha – Rura section. Cause:- Negligence of LP, Co LP & SM/Rura.
5	02.10.20	JAG G-3	BOBR:- Entering of train no. NPSB/Goods in Platform no. 2 of Mathura Station during Traffic/Power block between SM-50 Mathura to SM-270 Bhuteshwar. Cause:- Carelessness of Operating staff.
6	30.01.20	JAG H-2	SPAD:- LP of train no. LPGK Goods overshoot TDL home signal no. 198 in ON position. LP overshoot signal by 51 metre. Cause:- Negligence of LP/AGC & ALP/AGC.
7	02.02.20	JAG H-2	SPAD:- LP of train no. PIC Goods overshoot BDL home signal no. 3 in ON position. Cause:- Negligence of LP/ALD & ALP/ALD.
Yard Accident: (30)			
1	17.04.19	Sr. Sub. D-6	Derailment (SFG):- Derailment of Tower wagon no. RU8783 on open trap point no. 291 A at SFG yard. Cause: Driver of Tower wagon overlooked the 'ON' aspect of shunt signal no. 111.

2	25.04.19	Sr. Scale D-6	Derailment (Gwalior Yd.): - Derailment of one BLC wagon of train no. MKPP goods at GWL yard. Cause: -Unbalanced loading of wagon & improper operation of draw bar of wagon.
3	08.05.19	Sr. Scale D-6	Derailment (Khurja): - Derailment of Brake Van (BVZI) of DMT Spl. in ballast siding during shunting at KRJ Yard. Cause: - careless working of shunting staff.
4	26.06.19	Sr. Scale D-6	Derailment (ACOI Yd.): - Derailment of DMT wagon no. 70020260074 ER during shunting at ACOI yard. Cause: -Uneven unloading of ballast.
5	09.07.19	Sr. Scale D-6	Derailment (Barhan Yd.): - Derailment of one Empty BCN wagon during attaching on load. Cause: - Heavy bump during attaching engine with load.
6	10.07.19	Sr. Scale D-6	Derailment (Gwalior Yd.): -Derailment of one coach of train no. 11124 while shunting the rake for placement. Reason: - Ignoring point no. 173 which was already flashing when setting the reverse shunt.
7	13.07.19	Jr. Scale D-6	Derailment (GMC Loco Shed): -Loco no. 27955/ WAG-7/CNB side collided with Loco no. 32319/ WAG-9/CNB and derailed by all wheels of DLI end trolley. Cause: - Carelessness of loco shed staff Shri R. K Gautam/Tech.
8	15.07.19	Jr. Scale D-6	Derailment (ALD Yd.): - Derailment of two coaches of train no. 22438 during shunting from line no. 22 to 21 (washing line). Cause: -Washing pit collapsed.
9	27.07.19	Sr. Sub. D-6	Derailment (ALD Yd.): Derailment of DP no. 11273 WDM3D/SPJ at H.P. No. T61 in Coaching yard, ALD. Cause: - Point not proper set & locked.
10	31.07.19	Sr. Sub. D-6	Derailment (TDL Yd.): Derailment of AC L/Engine no. 32027/WAG9/NKJ during shunting at TDL yard. Cause: -During the movement, point no.13 was not locked.
11	04.08.19	Sr. Sub. D-6	Derailment (KID Yd.): Derailment of 1 BOBYN at new ballast siding at KID yard during shunting for placement. Cause: - Uneven loading.
12	07.08.19	Sr. Sub. D-6	Derailment (AGC Yd.): Derailment of DP near point no. 5 at sick line, AGC yard. Cause: - Due to the loose clamping of hand point no-05.
13	15.08.19	Sr. Sub. D-6	Derailment (JHS Yd.): Derailment of couple light engine of JHS-ALD passenger at JHS Yd. Cause: - Shunter overshot shunt signal no. 241 and derailed on point no. 446B. Responsibility: Shunter & Points man
14	16.08.19	JAG D-6	Derailment (RAMVA Yd.): Derailment of tower wagon at point no 43 at RAMA Yd. Cause: -Careless working of SM/RAMVA.
15	07.09.19	Sr. Scale D-6	Derailment (Firozabad Yd.): Derailment of 23 rd wagon from EP of E/Rake of BCN Goods from DW Malgodam siding. Cause: - Poor condition of track.
16	25.09.19	Sr. Sub. D-6	Derailment (Dhaulpur NG Yd.): Coach no. ECR 52179 (NG) derailed and another coach gone on two way at Hand point no. 04, during shunting on pit line to loop line in Dhaulpur yard Cause: - Point defective & Pointsman did not pad locked the hand point no. 4

17	29.09.19	Sr. Sub. D-6	Derailment (Aligarh Jn Yd.): Derailment of DLI end trolley, DLI end wheel in CD siding of BV of ALJN Spl. during placement of loaded rake at ALJN Yard. Cause- Excessive pushing back.
18	14.11.19	Sr. Sub. D-6	Derailment (AGC Yd.): A diesel power was coming from sick line to diesel shed towards DLI end after crossing shunt signal no. 130 derailed by 06 wheels at point no 262. Cause: Careless working of Pointsman.
19	15.11.19	Sr. Sub. A-5	Derailment (ALD Yd.): Two DLE side collided due to overlooking of shunt signal no 136 by one of the shunter of light engine in ALD yard. Cause:- Due to disregard of Shunt Signal no. 136.
20	21.11.19	Sr. Sub. D-6	Derailment (JHS Yd.): Derailment of Diesel Loco at derailing point no. 433 in JHS yard. Cause: LP did not observe shunt signal no. 237.
21	28.11.19	Sr. Sub. D-6	Derailment (JHS Yd.): Derailment of one BOBYN at Hand point no. 5 in JHS yard. Cause: Hand point no. 5 was not properly set and locked by Lever man.
22	16.12.19	Jr. Scale D-6	Derailment (SFG Yd.): DLI end trolley of wagon no. 6th (55018860016 CR/BRNA) of train no. DMT, derailed while coming out from CSP welding plant to SFG station. Cause: Track defect.
23	17.12.19	JAG B-7	Fire (CNB Yd.): Fire caught Coach no. S-6 and S-7 (NC 02230GSCN and NC 13324GSCN respectively) in New Coaching Complex/CNB of stable rake of train no. 04151/52 Prima facie cause: The exact reason behind the cause of fire could not be established as nothing could be concluded after analyzing the forensic report and all the probable cause.
24	18.12.19	Sr. Sub. D-6	Derailment (JHS Yd.): The rake of 51972 was on pushing back from shunting neck to Marshalling line no. 01. Pointsman on rear end failed to judge the dead end gap and moving rake bumped, causing derailment of both wheels of rear most axle of rear SLR. Cause: Negligence working by pointsman.
25	19.12.19	Sr. Sub. D-6	Derailment (JHS Yd.): Derailment of two wheels of first trolley of Diesel light engine at Hand point no. 08. Cause: Negligence by shunter and pointsman.
26	18.01.20	Sr. Scale D-6	Derailment (BAD Yd.): Derailment of two wagon 23 rd & 24 th from EP derailed at Hand point no 07 in BAD Yd. Cause: The proper setting of HP no 7 was not ensured by Shunting staff.
27	07.03.20	Sr. Scale D-6	Derailment (GMC Yd.): Derailment of one wagon due to shunting from line no 1 to 3 coal siding at GMC yard. Cause: Obstruction with big size coal pieces on track.
28	17.03.20	Sr. Scale D-6	Derailment (BANDA Yd.): Derailment of two wagon 5 th & 6 th from EP in BANDA goods shed line no 02. Cause: Urea bags and spare OHE portal upright, which were laid near the track at Malgodam siding, resulted entanglement with E/BCN wagons.
29	19.03.20	Sr. Scale D-6	Derailment (GMC Yd.): Derailment of one BLC wagon in line no. 22 at GMC Yd. Cause: Due to non availability of washer of pivot.
30	20.03.20	Sr. Scale D-6	Derailment (KSV Yd.): Derailment of one wagon at goods siding line no 1 at KSV Yd. Cause: Careless working done by crane operator.

Other Unusual:- (04)			
1	15.08.19	R-4	<p>Unusual:- Loco pilot of train No 51827 stopped due to heavy water logging on the track.</p> <p>Cause:- Water flowing from adjacent top of cutting, water logging in UP & DN track due to heavy rain.</p>
2	05.09.19	Sr. Scale R-5	<p>Misc. Accident (JhinguraYd.): Shunt signal broken by open dala of wagon no. 3rd from EP of train no. GN-45 Goods.</p> <p>Cause- Door of culprit wagon was not secured by CGS/TKD & failed to inform to concern TXR.</p>
3	06.01.20	Sr. Scale R-5	<p>Misc. Accident (Fire): Train no. 22181 stopped at km 1392/28 due to smoke occurred from smoldering of plywood due to overheating in blower heater of RMPU at AGC end door of 4th coach (96053/WGACCW/WCR) from engine.</p> <p>Cause: Due to overheating in blower heater of RMPU.</p>
4	06.01.20	JAG H-2	<p>Misc. Accident (SPAD):- Shunter of light engine overshot Shunt signal no SH169/S61 of line no. 17 in 'ON' position ALD Yd.</p> <p>Cause:-Negligence of Shunter.</p>