

Details of Accident

SN	Date	Category/ Div.	Brief Particular	Enquiry level	Enquiry completion (days) D+10	Cause	Responsibility	Punishment
A Consequential Train Accidents (02)								
1	15.10.21	D-4 PRYJ	Derailment (AAP-RRH): 24 wagons derailed of train no. DN GN-155 Goods (Load 58 BOXNHL+B/Van).	SAG (HQ)	62	Maintenance	Secondary : Track & Wagon	
2	26.11.21	B-3 JHS	Fire (DHO-HET): Fire in Coach no. A1 & A2 of Train no. UP 20848 Exp. at Hetampur station.	SAG (HQ)	11	Fire emerged from dustbin kept near by lavatory of the coach .	External & Forensic Report awaited	
B Non-Consequential Train Accidents (12)								
a Indicative Accidents (Nil)								
b Other Train Accidents (05)								
1	02.08.21	D-5 JHS	Derailment (Orchha-Barwa Sagar): Two wheels of loco no. 32996/WAG-9/CNB derailed at Km no. 1140/17 of train no. E/BCNHL Goods (Load 58 BCNHL+B/Van) due to bolder dashing on approaching to bridge. Speed of the train was about 60-65 KMPH. Dimensions of bolder (Granite block): 2.1x1.9x1.1 mtr	JAG	14	Due to boulder dashing (Bad weather)	Blameworthy- 1.Sh.Sarik Rafik,LP/JHS 2.Sh.Abhishek Meena/ALP/JHS 3.Sh.Surendra Singh Meena/Guard/JHS 4.Anil Toppo/SSE/C&W	1.Warning 2.Warning 3.Warning 4. WH one set pass.
2	10.08.21	D-5 PRYJ	Derailment: (GMC Yd.) Train no. PS-07 goods (EP No. 41090/AJ/WAG-9, Load 29 BOST/E +14 BRN/E + 01 BOXN/E + BVCM) started from line No. 12 at 1.09 hrs. and stopped at 01.17 hrs. LP reported EP derailed by all three axles of H/E trolley at point No.349. Movement held up in north line and south line. Load back in line no. 12 at 3.10 hrs and north line and south line cleared.	Sr. Scale	09	Defect in Diamond Crossing no.349 (Engg. Deptt.)	Primary :- Sh. R.K.Shrivastava, SSE/P-Way/GOY	WIT one year without CE.
3	11.08.21	D-5 JHS	Derailment: (JHS Yd.) - One wheel of DLI end trolley of 6th wagon from B/Van of train no. ICDG Goods derailed in bypass line no. 1. (Power No. 27447/WAG-7/CNB, Load 40 BLC/L + B/Van)	Jr. Scale	08	The train has been received in multiple loop by Operating department	Primary :- Optg. Deptt. Secondary- 1. Sh. Devendra jha/JE-P/WAY. 2. Shri A.S Chauhan, SSE/Sig./JHS	1.Recorded warning. 2. Warning.
4	03.10.21	D-5 PRYJ	Derailment: (DAQ-MXK):- Crew of train no. Dn DN-4 (Empty) Goods (EP no. 41107/WAG9/GMO, load 58 BOXNHL+B/Van) reported to Dy.SS/DAQ, One wagon 11th from EP derailed.	Sr./Jr. Scale	03	Foreign material defect	N/A	N/A
5	08.12.21	D-5 JHS	Derailment: (CIRL-DAA):- Gateman of gate no. 376/T and pointsman of Chirula station informed to Dy.SS/Chirula, One wagon 19th from B/Van of train no. DN JUD Goods (Power no.12229/WDG-4/SBI, load 38 BCN/E+B/van) derailed.	Jr. Scale	09	Hanging part	C&W/Satna/WCR	

c Yard Accidents (07)								
SN	Date	Category/ Div.	Brief Particular	Enquiry level	Enquiry completion (days) D+10	Cause	Responsibility	Punishment
1	14.04.21	D-6 JHS	Derailment (Morena Yd.)(DHO-JHS Section)- Two wagon no. 6th & 7th from EP BCN/L derailed in Goods loop line at point no.106 Morena yd. while pulling 21 BCN/L from new goods shed to DN goods loop line. Point of sudden drop, Dragging 197 mtrs. POD to POM- 50 cm. (Train no. ED/Spl. goods, EP no. 14856, Load 21BCN + B/Van)	Jr. Scale	55	Obstruction due to foreign body in the path of wheel.	Primary :- 1. Sh.Rakesh Singh ,CGSR/MBA/JHS) 2.Sh.Mahesh Meena/ccc/MRA Secondary- 1.Sh.Udayveer Singh Gurjar ,Guard/JHS 2.Sh.Data Ram,Points man/Muraina 3.Sh.Visnu Kumar,Points man/Muraina 4.Sh.A K Drivedi,LP/Goods/JHS 5.Sh.Ankit Choudhary, ALP/Goods/JHS	1.Warning 2. WIT 3 Month 1.Warning 2.Warning 3.Warning 4.WH 04 Sets Privilege Pass 5.WH 02 Sets Privilege Pass
2	15.06.21	D-6 AGC	Derailment (JAB Yd.): Diesel light engine (16082/WDM- 3A/JHS +B/Van) three wheels derailed at point no 296/A during shunting from line no 6 to line no 2. Shunter passed the shunt signal no 116.	Sr. Scale	08	Shunter could not stopped the locomotive and crossed the shunt signal.	Primary: Rajendra Kumar/Sr ALP/AGC	WIT Two year with CE.
3	21.06.21	D-6 PRYJ	Derailment (PCOI Yd.): Train no. SOP Goods (Power no. 31399/BIA, load 58 BCNHL + B/Van, 42 Loaded and 16 empty) arrived at PCOI in line no 15 at 13.35 hrs. Three wagons (Wagon no. 18, 19 & 20 from B/Van) derailed at point no 230/B during shunting from line no 15 to line no 06 at PCOI Yd.	Sr. Scale	15	Poor maintenance by Engg. Department.	Primary: Sri Rama Shankar/SSE/P-Way	WIT without CE.
4	14.08.21	D-6 AGC	Derailment (JAB Yd.): 21BCN/E was being placed from line no. 5 to line no. 3. Pointsman wrongly set the route to line no. 4 instead of 3. Due to this B/Van stabled at line no. 4,	Sr. Scale	05	Route wrongly set and negligence by shunting staff.	Primary: Sh. Girij Singh,Points man/JAB Blameworthy- Salim Khan/Shunting master/JAB	WIT one year. Warning.
5	16.09.21	D-6 PRYJ	Derailment (Kanpur Yd.): Derailment of 02 spare coach no. 205711derailed with both trolley and coach no. 171649 derailed with H/E trolley all wheels of wagon no. 12 th & 13 th from DP near point no. 208, during shunting from washing line no. 03 to sick line no. 02 in NCC/CNB yard.	Sr. Sub.	03	Point no. 3L not set properly.	Primary: Rajesh Paswan, Pointsman/CNB	WIT one year without CE.
6	17.10.21	D-6 JHS	Derailment (PIC Yd.): Light engine no. 32067/WAG-9 eight wheels derailed at point no 273 during shunting. LPG passed the shunt signal no 190 in on condition.	Sr. Scale	09	Shunt signal overlooked by crew	Primary: 1. Sh V. Kumar, LP/JHS 2. Sh. M. S Ojha, ALP/JHS Secondary: Sh. V.K Singh, Guard/Juhi.	1. SF-5 issued 02.11.21 2. SF-5 issued 05.11.21 Warning.
7	22.11.21	D-6 AGC	Derailment (Kosi Kalan Yd.): Two BFR wagons (24 th loaded & 25 th empty) of train no. DMT Goods (Loaded Rail panel) derailed at point no. 293 b at KM no. 1438/31-33.	Jr. Scale	26	The Layout of the Holding line of KSV was not proper. ESP designed for the line is not correct .	Primary: Sh. Akash Kaushik, SSE/P.Way/Const. Secondary: Sh. D Singh, SSE/P.way/KSV Blameworthy: Joint Signatories	